
Sciuce view of the second seco

CABLE CLEANER

- Removes pik without alcohol
- Minimal wiping (2 wipes only)
- No residue
- Safe to use on ribbon fiber
- Fans fiber quickly
- Fibers so clean they squeak!

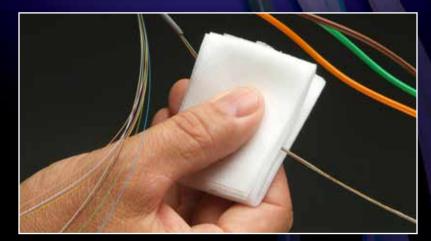

polywater.com/squeekykleen.asp

Polywater[®] SqueekyKleen[™] Cable Cleaner

New **SqueekyKleen[™]** cleans and fans fiber in two wipes without alcohol, saving time and money. Hear the difference! No follow-up with alcohol required to get fibers squeaky clean and separated for fast and easy splicing. **SqueekyKleen[™]** reduces chemical odors and harmful vapor concentrations in splice trailers and vaults while being less harsh on hands.

SqueekyKleen's unique formulation and specially designed high-performance towelette work to remove pik from the entire surface of loose tube or ribbon fibers, leaving no residue.

SqueekyKleen[™] helps keep splice equipment clean for better fiber alignment and splice quality. Will not harm acrylate on loose tube cable or Mylar[®] on ribbon fiber.

SPECIFICATIONS


Cleaning: When wiping a 3-foot section of 12-count fiber from a buffer tube, the pre-

saturated towel will squeak and fan fibers with 2 wipes.

Solvency Power: At 68° F (20° C), will dissolve .020" (.5mm) film of PE/PJ or ETPR grease completely from cable jacket with less than two minutes of vigorous agitation (no wiping).

Residue: When placed on a clean glass panel and dried, the solvent shall leave less than 100 parts per million of residue (<100 ppm).

Water Content: When tested by the ASTM 1533B method, water content shall be less than 75 ppm.



Flash Point: When tested via a Pensky-Martin Closed Cup Test (ASTM D93), the cleaner shall have a flash point above 140° F (60° C).

| CATALOG NUMBER | DESCRIPTION | STANDARD Shipping Package |
|----------------|---|------------------------------|
| TC-1 | SqueekyKleen [™] Telcom Cleaner–Saturated 8" x 12" (20 cm X 30 cm) Wipe | 144 |
| TC-16LF | 16-Oz (0.47 Liter) SqueekyKleen™ Telcom Cleaner w/Flip Top cap | 12 |
| TC-16LR | 16-0z (0.47 Liter) SqueekyKleen [™] Telcom Cleaner w/Sprayer | 12 |
| TC-35LF | Qt (0.95 Liter) SqueekyKleen™ Telcom Cleaner w/Flip Top cap | 12 |
| TC-35LR | Qt (0.95 Liter) SqueekyKleen™ Telcom Cleaner w/Sprayer | 12 |
| TC-128 | 1-Gal (3.8 Liter) SqueekyKleen™ Telcom Cleaner | 4 |
| TC-384 | 3-Gal (11.4 Liter) SqueekyKleen™ Telcom Cleaner (5-gal pail) | 1 |
| TC-640 | 5-Gal (19 Liter) SqueekyKleen™ Telcom Cleaner | 1 |
| TC-96 | 3-Qt (2.84 Liter) SqueekyKleen™ Telcom Cleaner (1-gal pail) | 4 |
| TC-D65 | 65-Count SqueekyKleen [™] Saturated 8" x 12" (20 cm X 30 cm) Wipe Canister | 6 |
| TC-D65DRY | 65-Count SqueekyKleen™ Dry 8" x 12" (20 cm X 30 cm) Wipe Canister | 6 |
| TC-D300 | 300-Count SqueekyKleen™ Saturated 6" x 5" (15 cm X 13 cm) Wipe Canister | 6 |
| TC-DRUM | 55-Gal Drum SqueekyKleen™ Telcom Cleaner | 1 |
| TC-1D42 | 42 TC-1 in a Dispenser Pack | 1 |

Important Notice: The statements here are made in good faith based on tests and observations we believe to be reliable. However, the completeness and accuracy of the information is not guaranteed. Before using, the end-user should conduct whatever evaluations are necessary to determine that the product is suitable for the intended use.

American Polywater expressly disclaims any implied warranties and conditions of merchantability and fitness for a particular purpose. American Polywater's only obligation shall be to replace such quantity of the product proven to be defective. Except for the replacement remedy, American Polywater shall not be liable for any loss, injury, or direct, indirect, or consequential damages resulting from product's use, regardless of the legal theory asserted.



1-800-328-9384 1-651-430-2270 fax 1-651-430-3634 custserv@polywater.com (e-mail)

polywater.com/squeekykleen.asp